



# STP Plug Termination Instruction

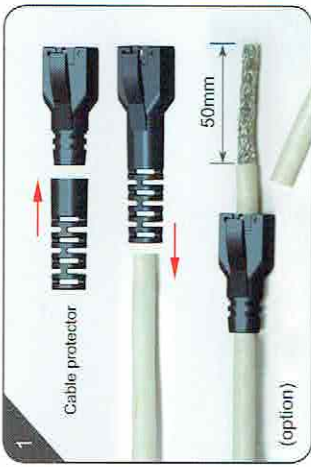


- 1. Put cable protector & boots together, and install to the cable before stripping.
- 2. Strip the cable jacket length about 50mm.




- 2. Bend back the copper braid over plastic jacket, cut each pair's aluminum foil to root.

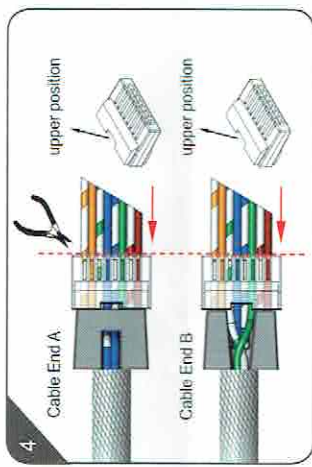


- 4. Select indented loadbar on upper side position, thread wires thru loadbar, comb wires.

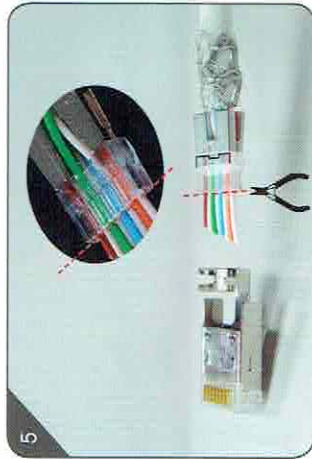

- 5. Cut excess wires to the root. (important)

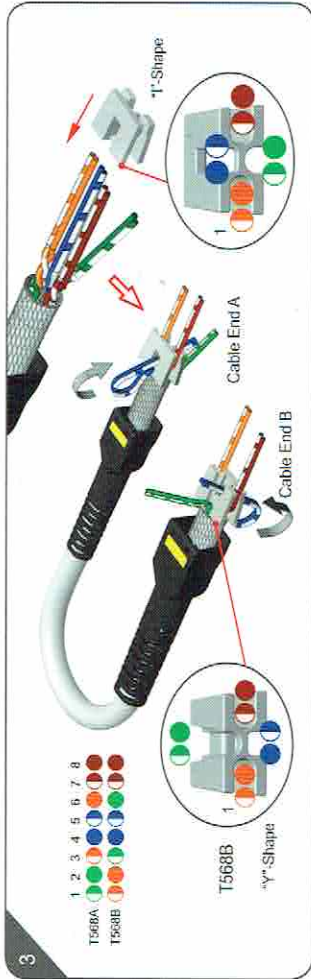


- 3. Insert 4 pair wires into the organizer, Blue pair direct to "Y-shape" organizer tunnel, Green pair direct to "Y-shape" organizer slot.

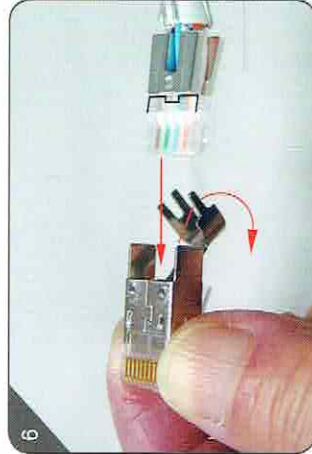


- 6. Turn the shield SR(hook) down in order to push wire-organizer into plug housing.




- 7. Crimp and terminate the wires, by crimping tool.

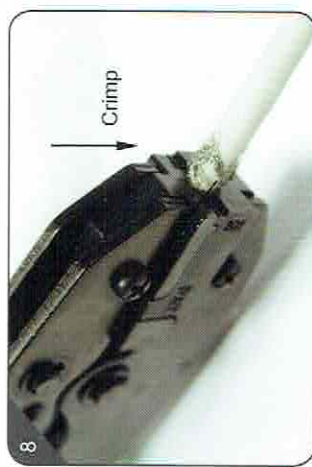

- 8. Crimp and hold down 1 ~ 2 sec.

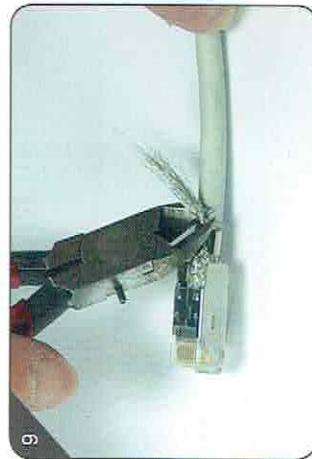

- 9. Cut the excessive copper braid.

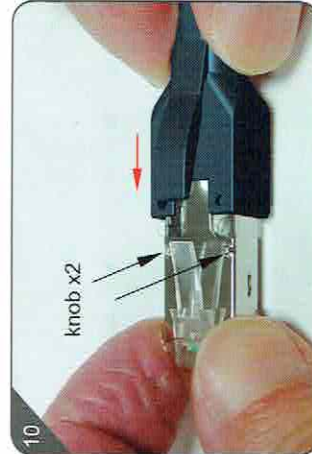

- 10. Position boots with 2 knobs.



- 11. Complete.

